

Release Notes

Product Name:	KDS-SW2-EN7			
Current Version:	Туре	Number	Date	
	Firmware	0.11.12	January 2023	
	Software	—	_	
	Web	—	_	
	Hardware	_	_	
RN Date:	January 30, 2023			
Reference:	18513			

Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
KDS-SW2-EN7	Any	Yes	Yes

Summary:

- Fixed a bug.
- Added feature(s).

Codependency with Other Products and Software:

Product Name	Comments

• There is no codependency with other products or software.





Release Notes

Product Name: Current Version:

KDS-SW2-EN7				
Туре	Number	Date		
Firmware	0.11.12	January 2023		
Software	-	_		
Web	-	_		
Hardware	-	_		
January 30, 2023				
10510				

RN Date: Reference: 18513

New Features:

New Feature Description
Unique Channel ID automatic assignment.
Round time zone support on Web UI & API.
Support add 2ch audio block to EDID from a DVI Sink in EDID passthrough mode.
Separate HTTP Security and P3K Security passwords.

Modifications:

Modification Description	
Password security improved – a strong password is required when the user changes the password.	
An improved method Import/Export Web UI to be user-friendly.	

Bugs Fixed:

QC ID	Fixed Bug Description
GB-683	The video auto-switching timeouts did not work.
GB-704	#NET CONFIG command did not work.
GB-711	#ETH-TUNNEL? command was not implemented.
GB-746	Switching time took about 5 sec (now 3).
GB-758	Sending a signal that has Dolby audio has no audio and the web UI pages of the devices show different audio formats.
GB-811	#NET-MAC command responded for out-of-range parameters.
GB-830	When "Security Status" is on, P3K does not return any response to any command sent, until #LOGIN with the correct details is sent.





Release Notes

QC ID	Fixed Bug Description
GB-835	When applying a custom EDID (user uploaded), trying to remove it did not indicate any error display on the Web UI webpage, the action wasn't performed, and the applied EDID wasn't removed from the list (as expected).
GB-847	The list that was returned by #SIGNALS-LIST command contained only the active video input.
GB-865	When choosing AUDIO analog on the input, there was no audio embedded on the KDS-DEC7 HDMI OUT.
GB-879	The input name now appears next to the input number in the web UI.
GB-900	Following a change of Maximum Bit Rate – a reboot is required in order change to take effect, but there was no message indicating it.
GB-906	When uploading a file with the wrong format (other than .pem) but with a valid size (<20kb), the wrong error message was displayed.
GB-907	Improved Import/Export Web UI to be clearer to the user.
GB-908	Log was open despite Active Syslog being OFF.
GB-914	There was a faulty recognition of the input signal ASPECT RATIO and RESOLUTION.
GB-915	Webpage – Device Factory reset did not meet Kramer standard.
GB-918	When rolling back the firmware to a previous version the webpage did not return feedback.
GB-919	It is now possible to have 2 channel audio blocks in the EDID received from a DVI sink.
GB-933	HDMI STATUS on the LCD menu displayed incorrect input resolution.
GB-847	The list returned by #SIGNALS-LIST includes only the active input.

Bugs to Fix in Future Versions:

QC ID	Deferred Bug Description
GB-866	After powering up the unit, the LCD and WEB display work slowly during the first 2 minutes.

Known Limitations (including compatibility limitations):

QC ID	Limitation Description	
	None listed	

Preceding Version: 0.8.6





Release Notes History

Product Name:	KDS-SW2-EN7			
Current Version:	Туре	Number	Date	
	Firmware	0.8.6	June 2022	
	Software	-	—	
	Web	-	_	
	Hardware	-	—	
RN Date:	June 2022			
Reference:	60-000990			

Kramer Product Affected:

Product Name	Minimum FW Version for Upgrade	Recommended for All Units	Only if Added Features are Required
KDS-SW2-EN7	N/A	N/A	N/A

Summary:

• This is a release note for a new product.





Release Notes History

Product Name:	KDS-SW2-EN7		
Current Version:	Туре	Number	Date
	Firmware	0.8.6	June 2022
	Software	_	-
	Web	-	-
	Hardware	-	-
RN Date:	June 2022		
Reference:	60-000990		

This is a release note for a new product. For a list of new product features see:

www.kramerav.com/manual/KDS-SW2-EN7

Bugs to Fix in Future Versions:

ID	Deferred Bug Description
GB-866	After powering up the unit, the LCD and WEB display work slowly during the first 2 minutes.
GB-847	The list returned by #SIGNALS-LIST includes only the active input.
GB-809	Getting gateway messages by using GTW-MSG-NUM doesn't filter messages by dates and displays all messages.
GB-821	Need to update the new Kramer address in the About page.
GB-765	When setting Syslog to OFF, file status displays 'log is open'.

Known Limitations (including compatibility limitations):

ID	Limitation Description
	None listed

Preceding Version: N/A

